

2901 Airport Drive, Torrance, California 90505

Page 1 of 2

R44 SERVICE BULLETIN SB-90

- DATE: 14 November 2016
- TO: R44 & R44 II Owners, Operators, and Maintenance Personnel
- **SUBJECT:** Revised Instrument Marking
- **ROTORCRAFT AFFECTED:** R44 Helicopters S/N 0004 thru 2449 and R44 II Helicopters 10001 thru 14026.
- **<u>TIME OF COMPLIANCE</u>**: Within next 100 flight hours or by 31 December 2016, whichever occurs first.
- **BACKGROUND:** Pilot's Operating Handbook (POH) revision dated 21 October 2016 adds a yellow arc above 110 knots to the airspeed indicator. This bulletin requires installing a decal (placard) specifying revised precautionary range adjacent to earlier instruments and revising, if installed, airspeed indication of Aspen or Garmin electronic flight display.

COMPLIANCE PROCEDURE:

- 1. If installed airspeed indicator green arc is 0–130 knots (or 0–241 km/h) install G654-6 decal as shown. If indicator has a yellow arc above 110 knots (or 204 km/h), decal is not required.
- 2. If electronic flight display is installed, have applicable authorized Aspen (<u>www.aspenavionics.com</u>) or Garmin (<u>www.garmin.com</u>) facility revise airspeed indication to match 19 October 2016 POH revision.

APPROXIMATE COST:

- Parts: No charge for G654-6 decal (included with SB mailing). \$1.10 for each additional G654-6 decal. \$145 for overhaul-exchange C599-1R (130 knots V_{ne}) or C599-6R (241 km/h V_{ne}) indicator.
- Labor: 0.2 man-hour (excluding electronic flight display update).

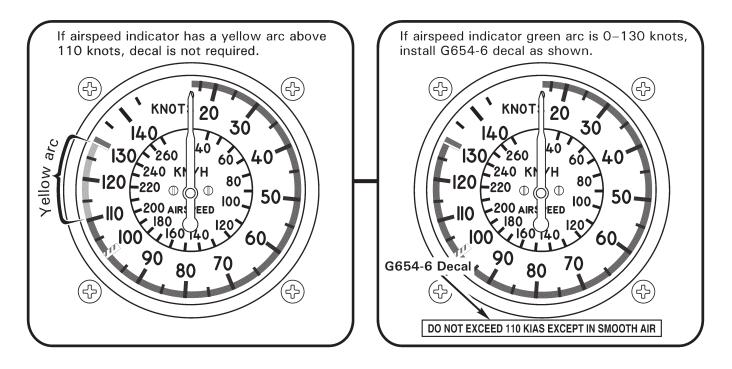


FIGURE 1